



SERVICE NOTICE

SUBJECT: Garmin G1000 Service Bulletin 1353
EFFECTIVITY: KODIAK 100 Series Aircraft

BACKGROUND

Reference attached Garmin Service Bulletin 1353.

DISCUSSION

Quest Aircraft Company recommends that attached Garmin Service Bulletin 1353 be examined immediately and the recommendations therein be followed.

INSTRUCTIONS

Reference attached Garmin Service Bulletin 1353 for information. If you have any questions, please contact your local Garmin Dealer.

Quest Customer Service
Service Notice: SN13-13
Phone: (208) 263-1111 Toll Free: 1(866) 263-1112
Email: customerservice@questaircraft.com



SERVICE BULLETIN

NO.: 1353

TO: All Garmin Aviation Service Centers
DATE: September 23, 2013
SUBJECT: Loading GIA COM and NAV Software

PURPOSE

Loading GIA COM and NAV software from an SD card that contains the same GIA COM and NAV software versions already installed on the GIA may result in an inoperable GIA 63W/GIA 63H.

DESCRIPTION

Do not initiate a GIA COM or NAV software upload if the COM or NAV software version on the SD card matches the COM or NAV software version already installed on the GIA.

When loading system software do not use the CHK ALL softkey if you have a 011-01105-20/011-01105-40 (GIA 63W) or 011-01105-30 (GIA 63H) in conjunction with GIA main software versions prior to 7.05.



Do not use the CHK ALL softkey.

© Copyright 2013
Garmin Ltd. or its subsidiaries
All Rights Reserved

Except as expressly provided herein, no part of this document may be reproduced, copied, transmitted, disseminated, downloaded or stored in any storage medium, for any purpose without the express prior written consent of Garmin. Garmin hereby grants permission to download a single copy of this document and of any revision to this document onto a hard drive or other electronic storage medium to be viewed and to print one copy of this document or of any revision hereto, provided that such electronic or printed copy of this document or revision must contain the complete text of this copyright notice and provided further that any unauthorized commercial distribution of this document or any revision hereto is strictly prohibited.

AFFECTED PRODUCTS

All G1000, G2000, G3000, G1000H, G5000H, Cirrus Perspective, Embraer Prodigy, G950, and G900X installed with a 011-01105-20/011-01105-40 (GIA 63W) or 011-01105-30 (GIA 63H) in conjunction with GIA main software versions prior to 7.05 are affected. GIA part numbers and software versions can be viewed on the SYSTEM STATUS page in configuration mode.

APPROVAL

N/A

AFMS AND PILOT'S GUIDE CONSIDERATIONS

There are no changes to the AFMS or pilot's guide documents that are resultant from this bulletin.

COMPLIANCE

Compliance with this service bulletin is recommended.

REFERENCES

N/A

MANPOWER

N/A

WARRANTY INFORMATION

This modification is not warranty reimbursable.

MODIFICATION INSTRUCTIONS

N/A

TESTING PROCEDURE

N/A

MATERIAL INFORMATION

N/A