

MANDATORY SERVICE BULLETIN

NUMBER: SB-012 **AMENDMENT 1**

DATE: 7/09/2009

SUBJECT: FUEL SYSTEM; MANDATORY INSPECTION (WING) **AMENDMENT 1**

SUMMARY

RECURRENT REQUIREMENTS


No recurrent requirements associated with this Mandatory Service Bulletin.

BACKGROUND

Quest is requiring a one-time inspection of the wing fuel tank outlet port connections. The inspection will consist of ensuring Pro-Seal fuel sealant is present on the threads of the fuel tank outlet port (P/N 100-828-4405).

ACTION

Inspect the wing fuel tank outlet port connections as prescribed in the instructions attached.

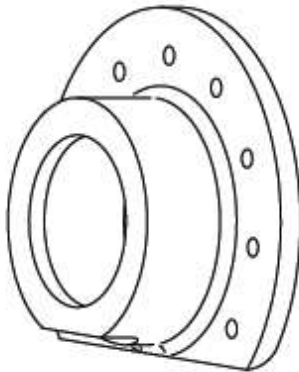

ISO VIEW
NOT TO SCALE
FOR REF ONLY

Figure 1: Fuel Tank Outlet Port

EFFECTIVITY

Serial Numbers 100-0001 through 100-0009

AFFECTED PARTS

KODIAK PART AFFECTED:

- P/N 100-828-4405

REPLACEMENT PART FOR AIRCRAFT RECORDS:

- N/A

COMPLIANCE

The inspection portions of is Mandatory Service Bulletin must be completed no later than next scheduled maintenance interval, if no leaks are noted then repairs can be deferred to next annual service.

INDUSTRY SUPPORT INFORMATION

None

MANPOWER

The instructions contained in this Service Bulletin will take 4.0 hours to complete the inspection. If Pro-Seal application is needed, an additional 3.0 hours required.

COMPLETION

Update the KODIAK Maintenance Log Books.

WARRANTY INFORMATION

This modification is warranty reimbursable for the manpower listed above after Quest Aircraft has been notified of your completion.

Quest Aircraft Company, LLC
© Copyright 2008
All Rights Reserved

No part of this document may be reproduced, copied, transmitted, disseminated, downloaded or stored in any storage medium, for any purpose without the express prior written consent of Quest Aircraft Company, LLC.

MANDATORY SERVICE BULLETIN

MANDATORY SERVICE BULLETIN