

MANDATORY SERVICE BULLETIN

REVISION RECORD

REV	DATE	PAGE	CHANGE DESCRIPTION
00	05/05/26	ALL	Initial release.

SUBJECT

Kodiak Rudder Closeout Fairing Clearance

EFFECTIVITY

Original Effective Date: 05/05/2026

Kodiak 100 Serial Range: 100-0001 thru 100-0371

Kodiak 900 Serial Range: K2-0002 thru K2-0016

SUMMARY

Affected Kodiak airplanes must be inspected to evaluate clearance between the Rudder Closeout Fairing and any adjacent aircraft structure. Damage may occur to the Vertical Spar and the Rudder Torque Tube Collar caused by rubbing from the Rudder Closeout Fairing. There should be a minimum 0.060" of clearance from the Rudder Closeout Fairing and any adjacent structure to prevent touch interference.

COMPLIANCE

This Mandatory Service Bulletin must be complied with at or before the next annual inspection.

SPECIAL INSTRUCTIONS

Inspect the perimeter of the Rudder Closeout Fairing for proper clearance. If an aircraft is found to have less than 0.060" of clearance from the Rudder Closeout Fairing and any adjacent structure, but is not contacting any structure, the fairing should be trimmed to accomplish 0.060" gap. If the fairing is contacting any structure and causing wear, please contact Kodiak Care for further guidance.

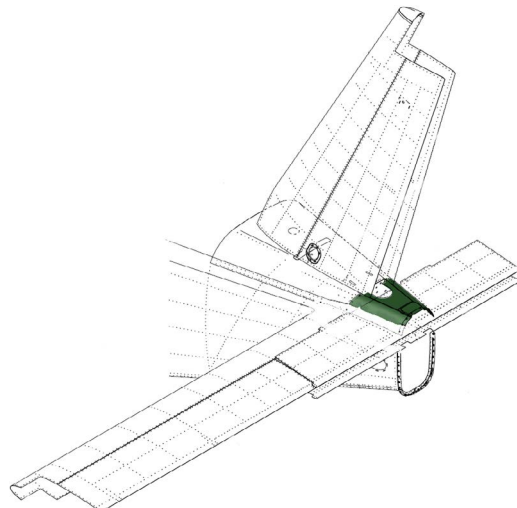


Figure 1: Rudder Closeout Fairing

MANDATORY SERVICE BULLETIN**FAA APPROVAL STATUS**

The resultant alteration or repair to the affected airplane described above has been shown to comply with the applicable FAA regulations and is FAA approved.

CREDIT AND WARRANTY INFORMATION

For airplanes within the factory warranty, Kodiak will reimburse up to 0.5 hours of the labor to perform the clearance inspection. For aircraft experiencing contact, additional labor allowances may be provided. Work must be performed by a Kodiak Service Center or technician who has completed Daher approved Kodiak Maintenance training. This offer will be valid for one (1) year and one (1) month from release of this Service Bulletin.

Refer to Kodiak Aircraft Company's technical publications portal at <https://kodiakcare.aero> for warranty claim instructions.

Kodiak Aircraft Company
1200 Turbine Drive
Sandpoint, Idaho 83864

Kodiak Care
Toll Free: 1 (866) 263-1112
Email: care@daher.com